



1 – ENGINE

505 V6: Modification to the fan coupling

From serial number : 1.999.220

The coupling rated at 75°C is replaced by a coupling rated at 80°C.

Identification

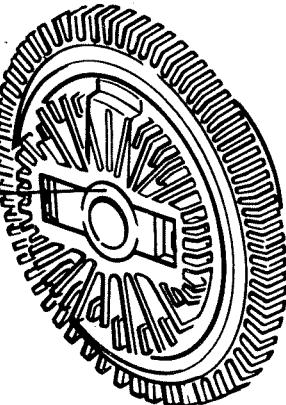
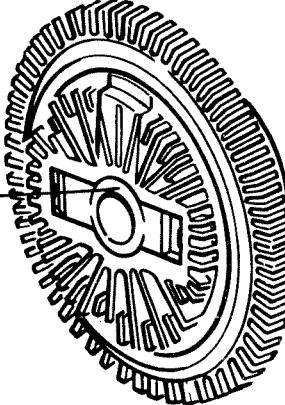
| Earlier assembly | Later assembly |
|--|--|
|  |  |
| Not supplied by Parts | Part Number 1259.20 |

Interchangeability:

- Parts will supply only the coupling rated at 80°C Part Number 1259.20.
- Replacing a coupling rated at 75°C by one rated at 80°C requires the following modifications:

Vehicles with manual gearbox and no air conditioning

- Disconnect wire 47A from the thermistor (1) and lengthen it with 0,6 mm² wire to connect it to the thermal switch (2) before passing through the convoluted sleeve (3).
- Fit an expansion bottle cap rated at 1 bar (coloured orange) Part Number 1303.42.

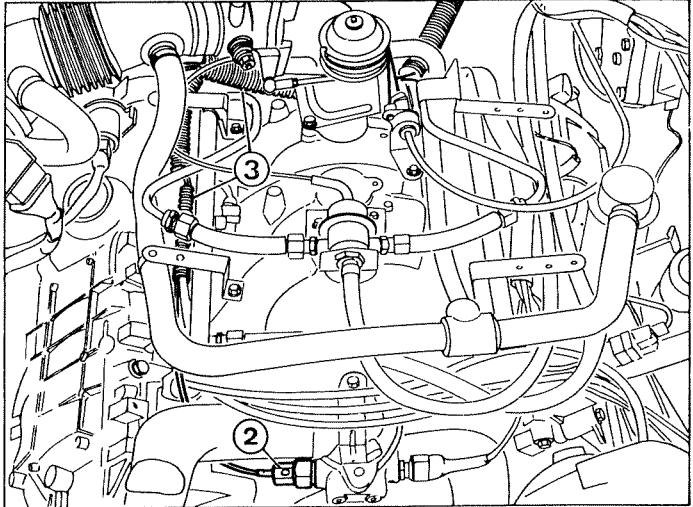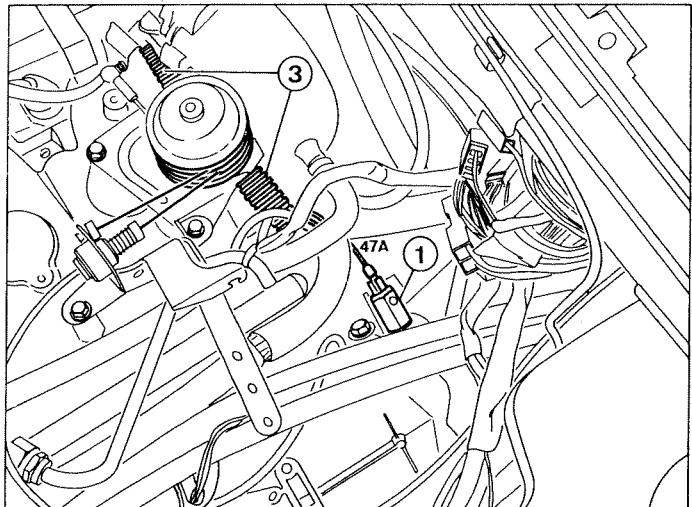

Vehicles with automatic transmission and vehicles with air conditioning

- Replace the thermal switch (4) in the radiator by a thermal switch Part Number 1264.18 (93° – 88°, 97° – 92° coloured white).

